

Service Bulletin

4812 715 40457

AUTHOR

Adriano Paradiso Aiello

Last Update

05/23/18

VERSION

1.0

Condensation Issue On VULCANO Model Range - Service Procedure

Reopen the hole of the chimney. Press with a screw driver the blocking shield in the position of the chimney to the outer side.

From outside:

- take out oven from cabinet
- remove all metal parts to get access to cooling fan
- remove cooling fan, ventilation channel, and ceiling to get access to wrapper insulation
- make a positioning hole from inside threw ventilation channel, 230 mm from frontal frame in it's middle (as shown on picture)
- use a "hole-cutter" Ø20mm and twisting it cut hole threw all layers (2xalu foil+rock wool)
- remove all the pieces (wool and alu foil) to see chimney hole in cavity
- put back all parts
- start oven with cooling fan in function to remove all potential pieces of insulation and alu foil, should be blow out threw ventilation slots in frontal frame





From September 2016 the production will reintroduce the hole.

ERROR CODE

X20 8220 Kx B

